

PAID -
DJ SFAC cc

Toy Shop
4818 Geary Boulevard
San Francisco, CA. 94118
Phone: 415-386-0122 Fax: 415-386-0185

INVOICE
49177

BAR #ARD239942
EPA #CAL000334247

Invoice from History

Work Completed : 11/12/2019 Date: 11/18/2019



1985 Toyota - Corolla GT-S - 1.6L, In-Line4 (96C1) VIN(A)
Lic # : 00006 Odometer In : 109710
Unit # : 03/85
VIN # : JT2AE88C3 F0145005

Part Description	Number	Qty	Sale	Ext	Labor Description	Ext	
SLAVE CYLINDER, CLUTCH W31470-12050		1.00	92.03	92.03	CUSTOMER REPORTS: PERFORM SCHEDULED MAJOR SERVICE. STARTER STAYS ON AT TIMES WHEN STARTING, INSPECT AND REPORT. REPLACE CLUTCH SLAVE CYLINDER. REMOVE REAR WINDSHIELD SUNSHADE. JOB 1: REMOVE TIMING BELT COVERS. REMOVE AND REPLACE TIMING BELT, REPLACE TENSIONER AND INSPECT BEARINGS, INSPECT WATER PUMP AND REPLACE THERMOSTAT, REPLACE CAMSHAFT SEALS AND CRANKSHAFT SEAL. RE-INSTALL TIMING BELT COVERS, RE-INSTALL DRIVE BELTS AND CHECK TENSIONERS. CHECK TIMING AND IDLE SPEED. CHECK AND REPLENISH FLUID LEVELS. ROAD TEST. SCHEDULED MAJOR MAINTENANCE SERVICE. REPLACE SPARK PLUGS, REPLACE AIR FILTER. CHECK PCV SYSTEM. CHECK IGNITION SYSTEM AND CIRCUITS, CHECK EFI SYSTEM AND COMPUTER FOR TROUBLE CODES. CHECK TIMING AND IDLE SPEED. CHANGE ENGINE OIL AND FILTER. CHANGE TRANSMISSION FLUID AND DIFFERENTIAL OIL. REPLACE PLUG GASKETS. DRAIN AND FLUSH COOLING SYSTEM. ADD COOLANT AND PRESSURE TEST FOR LEAKS, CHECK COOLING SYSTEM HOSES. CHECK THERMOSTAT, RADIATOR AND COOLING FAN OPERATION. CHECK OPERATING TEMPERATURE. CHECK BRAKE LININGS, CALIPERS, HOSES AND CYLINDERS. FLUSH AND BLEED BRAKE HYDRAULIC SYSTEM. CHECK AND ADJUST BRAKES AND PARKING BRAKES. ROTATE WHEELS. CHECK LIGHTS AND BRAKE LIGHTS. ROAD TEST. FRONT: 6mm(DISC) REAR: 6mm(DISC) *BOTH REAR TIRES ARE WEARING UNEVENLY CAUSING VIBRATION WHEN DRIVING. RECOMMEND REPLACING REAR TIRES.* JOB 3: INSPECT AND TEST STARTING SYSTEM. TEST BATTERY AND CONNECTIONS. INSPECT AND TEST IGNITION SWITCH, SAFETY SWITCHES AND CIRCUITS TO STARTER MOTOR. FAULTY STARTER SOLENOID CAUSING STARTER TO STAY ON AT TIMES. REMOVE EXHAUST MANIFOLD. REMOVE AND REPLACE STARTER. RE-INSTALL MANIFOLD, RECHECK STARTING SYSTEM AND CIRCUITS, OK. ROAD TEST. JOB 4: CLUTCH SLAVE CYLINDER WORN AND LEAKING. REMOVE AND REPLACE CLUTCH SLAVE CYLINDER. INSPECT CLUTCH MASTER CYLINDER, OK. FLUSH AND BLEED CLUTCH HYDRAULIC SYSTEM. CHECK CLUTCH OPERATION, OK. ROAD TEST. JOB 5: REMOVE REAR HATCH SUN SHADE LOUVER ASSEMBLY. INSTALL DOOR SILL TRIM MOULDINGS AND MOUNTING CLIPS. INSTALL HOOD ROD MOUNTING CLIPS.	n/c	
STARTER, REMAN. DENSO W280-0252		1.00	152.64	152.64			
BELT, TIMING 13568-19145		1.00	38.67	38.67			540.00
TENSIONER, TIMING BELT W13505-16021		1.00	148.14	148.14			
SEAL, CAMSHAFT W90311-35040		2.00	14.25	28.50			
SEAL, CRANKSHAFT W90311-32020		1.00	8.39	8.39			
THERMOSTAT W90916-03046		1.00	28.69	28.69			300.00
GASKET, THERMOSTAT W16325-70021		1.00	1.72	1.72			
ANTIFREEZE/COOLANT 00272-1LLAC-01		1.00	25.41	25.41			
OIL, MOTOR KENDALL 5W/30 SYN/BLEND		4.00	5.02	20.08			
FILTER, OIL 90915-YZZF2		1.00	5.41	5.41			
GASKET, PLUG 90430-12031		1.00	1.00	1.00			
OIL, GEAR SYNTHETIC 75W/90		5.00	9.21	46.05			240.00
GASKET, PLUG 90430-18008		4.00	1.19	4.76			
ADDITIVE, LSD 4285V		1.00	10.70	10.70			
FLUID, BRAKE DOT 4		2.00	9.25	18.50			180.00
FILTER, AIR 17801-16010-83		1.00	16.55	16.55			
PLUG, SPARK (PLATINUM) 90919-01121-83		4.00	8.52	34.08			
GROMMET, HOOD ROD 90480-15002		1.00	3.28	3.28			n/c
CLAMP, HOOD SUPPORT 53455-12030		1.00	5.52	5.52			
CLIP 90467-07041-C0		8.00	1.49	11.92			

Our Email Address: TOYSHOPBILLING@GMAIL.COM

182.64	182.64	1.00	1.00	REAR WINDSHIELD SUNSHADE	REAR WINDSHIELD SUNSHADE
38.87	38.87	1.00	1.00	BELT TIGHTENING	BELT TIGHTENING
148.14	148.14	1.00	1.00	TENSIONER TIGHTENING	TENSIONER TIGHTENING
28.50	14.25	2.00	2.00	SEAL CAMSHAFT	SEAL CAMSHAFT
8.58	8.58	1.00	1.00	SEAL CRANKSHAFT	SEAL CRANKSHAFT
28.89	28.89	1.00	1.00	THERMOSTAT	THERMOSTAT
1.73	1.73	1.00	1.00	GASKET THERMOSTAT	GASKET THERMOSTAT
25.41	25.41	1.00	1.00	ANTIFREEZE/DILUANT	ANTIFREEZE/DILUANT
20.08	20.08	4.00	4.00	OIL MOTOR KENDALL	OIL MOTOR KENDALL
8.41	8.41	1.00	1.00	FILTER OIL	FILTER OIL
1.00	1.00	1.00	1.00	GASKET PLUG	GASKET PLUG
48.08	48.08	8.00	8.00	OIL GEAR SYNTHETIC	OIL GEAR SYNTHETIC
4.78	4.78	4.00	4.00	GASKET PLUG	GASKET PLUG
10.70	10.70	1.00	1.00	ADDITIVE LSD	ADDITIVE LSD

Org. Estimate 1,982.25 Revisions 0.00 Current Estimate 1,982.25

Labor:	1,260.00
Parts:	702.04
SubTotal:	1,962.04
Tax:	59.67
Total:	2,021.71
Bal Due:	\$0.00

[Payments - Visa - \$2,021.71]
 Vehicle Received: 11/12/2019

Customer Number : 12500

I hereby authorize the above repair work to be done along with the necessary material and hereby grant Toy Shop and /or your employees permission to operate the vehicle described for testing and/or inspection. Service work performed is warranted for 12 months or 12,000 miles, whichever occurs first. We will not cover abuse or misuse. Work under this warranty must be done in our shop, unless authorized by TOY SHOP. Repair, replacement or refund will be at our discretion. We do not warranty or guarantee parts supplied by vehicles owner. This warranty is non-transferable. Toy Shop is not responsible for loss or damage to cars or articles left in cars

Signature _____ Date _____

Our Email Address: **TOYSHOPBILLING@GMAIL.COM**



Diamond Tire Center of Marin Inc

1133 Francisco Blvd East, Suite K
San Rafael, CA 94901
(415) 459-3808

BAR#ARD00245535 CA ID# 1439587-01

Bill To: [Redacted]

YR _____ Make _____ Mdl _____ Lic _____ Mileage _____

Description 1	Attribute	Size	Orig Price	Disc %Type	Qty	Price	Ext Price Tax
Install4		Install4			1		
Balance		Balance	\$20.00		4	\$20.00	\$80.00
California Mandatory Tire Fee		CA Tire Tax	\$1.75		4	\$1.75	\$7.00
EPA Disposal Fee		CA Dispos	\$4.50		4	\$4.50	\$18.00
Set Air Pressure on all tires		Set Air	\$0.00		4	\$0.00	\$0.00
185/60R14 TP Touring Uniroyal		1856014	\$100.37	0.42%	4	\$99.95	\$399.80 T
4- Wheel Alignment			\$129.95	100%	1	\$0.00	\$0.00

Subtotal: \$504.80

Local Sales Tax 9.25 % Tax + \$36.98

RECEIPT TOTAL: \$541.78

Credit Card: \$541.78 Visa

Total Deposit Taken: \$0.00
Balance Outstanding: \$0.00

From Work Order #118246

All Labor has a 90 day Warranty We offer no mileage Warranty

AE86 Corolla tires

SAN FRANCISCO TOYOTA

PARTS INVOICE

4099 Geary Blvd. at 4th Ave.
 Phone (415) 750-8300
 B.A.R. #AF25222

1701 Van Ness Ave.
 San Francisco, CA 94109-3620
 Phone (415) 592-0851

WHOLESALE PARTS - (415)592-0854

THANK YOU FOR CHOOSING SAN FRANCISCO TOYOTA!
 ELECTRICAL PARTS CANNOT BE RETURNED.
 SPECIAL ORDERS CANNOT BE CANCELLED OR
 RETURNED. RETURNS MUST BE IN ORIGINAL
 UNDAMAGED PACKAGE.

CUST. NO.	TAX EXEMPT NUMBER	CUST. P. O. NO.	SHIP VIA	PAY	SOLD BY	INVOICE DATE	INVOICE
326238	SRJH98-016011	DAVID		VISA MC	WILLIAM DURAN-RO	12/08/22	318957 TOW



B
I
L
L
T
O

S
H
I
P
T
O
 85 COROLLA
 JT2AE88C3F0145005

QUANTITY		PART NUMBER / DESCRIPTION	BIN	LIST	NET	AMOUNT
SHIP	B. O.					
1	0	23220-16430 PUMP ASSY, FUEL 1 DAY	SO	474.43	355.82	355.82
2	0	96135-51300 CLIP, HOSE	B8D6	3.94	2.96	5.92
1	0	23239-16010 HOSE 3DAY	SO	2.79	2.09	2.09
1	0	23249-43080 RUBBER, CUSHION 1DAY	SO	40.08	30.06	30.06
1	0	23300-19085 FILTER ASSY, FUEL 3DAY	SO	47.28	35.46	35.46
1	0	23217-16043 FILTER 3DAY	SO	23.85	17.89	17.89

WARNING

Many vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and parts and materials used to maintain vehicles, including, but not limited to, fuel, oil, coolant, brakes, and wheel balancing weights. When you service, clean, or maintain your motor vehicle, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, and shop paint, certain replacement parts, and particulates from component wear. When we service your motor vehicle, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm.

To minimize your exposure when servicing, maintaining, or cleaning your vehicle: 1) work in a well-ventilated area; 2) do not smoke, drink, or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components.

(Printed in accordance with Proposition 65 in Cal. Health & Safety Code § 25249.5(a) and (b). For further information about Proposition 65, visit <http://www.cdph.ca.gov/Programs/CID/DCDC/Pages/Prop65/Pages/prop65.aspx>

NOTICE: ALL SPECIAL ORDER PARTS CASH IN ADVANCE. All claims and returned goods must be accompanied by this invoice. Fifteen Percent (15%) restocking charge on ALL returned parts. NO RETURNS AFTER 10 DAY. **NO REFUNDS ON SPECIAL ORDER AND ELECTRICAL PARTS**

TERMS: ALL ACCOUNTS DUE AND PAYABLE 10th OF MONTH FOLLOWING PURCHASE DATE. PAST DUE ACCOUNTS ARE SUBJECT TO A FINANCE CHARGE OF 1 1/2% PER MONTH (18% ANNUAL RATE) WHICH WILL BE APPLIED TO OUTSTANDING BALANCE. CUSTOMER ALSO AGREES TO PAY REASONABLE ATTORNEY FEES AND/OR COLLECTION FEES.

REC'D BY **X**

See Warranty Information on Reverse Side

SUBTOTAL 447.24

TAX 0.00

FREIGHT 0.00
 PAY THIS AMOUNT 447.24

Thank You!
 WE APPRECIATE
 YOUR
 PATRONAGE


The Reynolds and Reynolds Company TRAINING SF634414 Q (03/08)

Northgate Automotive

181 Paul Dr
 San Rafael, CA 94903-2041
 Ph: (415) 479-7544
 Northgateautomotive@comcast.net



Invoice #610
 Service Writer: Breno
 Date: 04/19/23 09:26 AM

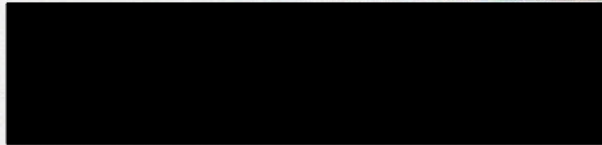

1985 Toyota Corolla RWD

L4-1587cc 4A DOHC
 VIN: JT2AE88C3F0145005
 License Plate: 00006 CA Mileage: In 110803 | Out 110803

ITEM	DESCRIPTION	QUANTITY	PRICE	TOTAL
Fuel Pump				720.00
Labor	Customer had a vehicle towed in stated that fuel pump is not working replaced fuel pump, dropped fuel tank and removed cover in trunk to unplug fuel pump and Sending Unit as well as replaced fuel filter. Charge vehicle battery overnight vehicle started with no problems. Customer supplied all parts.			720.00

Signature _____

Save Replacement parts for inspection or concern: Yes No

Payment is expected at the time of completion. All parts are new unless otherwise specified. The shop is not responsible for any damage to vehicle caused by theft, fire or circumstances beyond our control. The Shop Supplies and Hazardous Materials Fees represents costs to the motor vehicle repair facility for miscellaneous supplies or waste disposal. A vehicle storage fee will be charged daily for vehicles left on-site after 48 hours from notice of work completion. Replaced parts will only be saved or returned to customer upon request. From date of delivery for a period of 4000 miles or 90 days, whichever comes first, this firm will repair free of charge any damages in materials and workmanship to the repairs stated on the invoice all work to be done in the shop only. Does not include towing or a customer supplied part.

Authorizer	Date	Authorization Method	Shop Representative	Add. Amount	Total
------------	------	----------------------	---------------------	-------------	-------

Payments:			
Date	Method	Reference #	Amount Paid
4/19/23 (09:27AM)	Credit Card - Visa		\$720.00
Total Payments			\$720.00

Parts:	\$0.00
Labor:	\$720.00
Shop Supplies:	\$0.00
HazMat:	\$0.00
Subtotal:	\$720.00
Total Tax:	\$0.00

Invoice Total:	\$720.00
Payments	-\$720.00
Balance:	\$0.00